


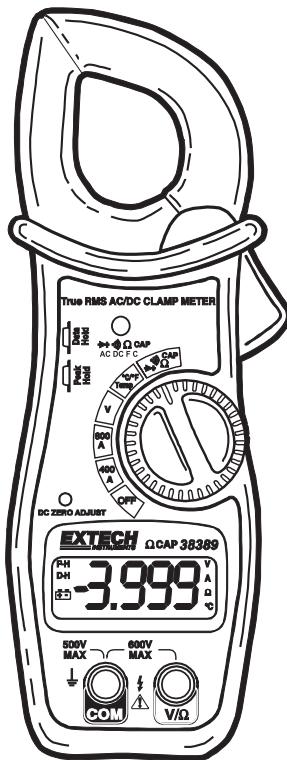

# User's Guide

## 600A True RMS AC/DC Clamp Meter

Model 38389



# Safety

---

## International Safety Symbols



This symbol, adjacent to another symbol or terminal, indicates the user must refer to the manual for further information.



This symbol, adjacent to a terminal, indicates that, under normal use, hazardous voltages may be present



Double insulation

## SAFETY NOTES

- Do not exceed the maximum allowable input range of any function
- Do not apply voltage to meter when resistance function is selected.
- Set the function switch OFF when the meter is not in use.
- Remove the battery if meter is to be stored for longer than 60 days.

## WARNINGS

- Set function switch to the appropriate position before measuring.
- When measuring volts do not switch to current/resistance modes.
- Do not measure current on a circuit whose voltage exceeds 600V.
- When changing ranges using the selector switch always disconnect the test leads from the circuit under test.
- Do not exceed the maximum rated input limits.

## UL

A UL mark does not indicate that this product has been evaluated for the accuracy of its readings.

## CAUTIONS


- Improper use of this meter can cause damage, shock, injury or death. Read and understand this user manual before operating the meter.
- Always remove the test leads before replacing the battery or fuses.
- Inspect the condition of the test leads and the meter itself for any damage before operating the meter. Repair or replace any damage before use.
- Use great care when making measurements if the voltages are greater than 25VAC rms or 35VDC. These voltages are considered a shock hazard.
- Remove the battery if the meter is to be stored for long periods.
- Always discharge capacitors and remove power from the device under test before performing Diode, Resistance or Continuity tests.
- Voltage checks on electrical outlets can be difficult and misleading because of the uncertainty of connection to the recessed electrical contacts. Other means should be used to ensure that the terminals are not "live".
- If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

Input Limits	
Function	Maximum Input
A AC, A DC	600A
V DC, V AC	600V DC/AC
Resistance, Capacitance, Diode Test	250V DC/AC
Temperature	60V DC, 24V AC


## Meter Description

---

1. Current clamp
2. Data Hold button
3. Peak Hold button
4. Mode select button
5. ZERO button
6. LCD display
7. COM input jack
8. Clamp trigger
9. Rotary Function switch
10. V/Ω/□ CAP/TEMP jack

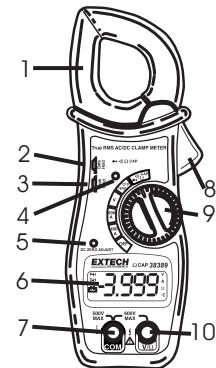

1. AC (alternating current) and DC (direct current)
2. Minus sign
3. 4000 count (0 to 3999) measurement reading
4. AutoRange mode
5. Peak Hold mode
6. Diode test mode
7. Audible Continuity
8. Data Hold mode
9. ZERO (Relative) mode
10. Low Battery icon
11. Units of measure list

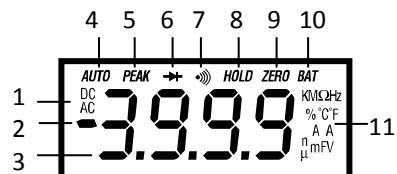

## Specifications

---

Function	Range & Resolution	Accuracy (% of reading)
DC Current	400.0 ADC	0 to 70A: ± (2.5% + 0.6A) 70 to 300A: ± (3.0% + 0.3A) 300 to 400A: ± (3.5% + 0.3A)
	600 ADC	0 to 150A: ± (2.5% + 4A) 151 to 350A: ± (3.0% + 4A) 351 to 600A: ± (4.0% + 6A)
AC Current	400.0 AAC	0 to 70A: ± (3.0% + 0.6A) 70 to 300A: ± (3.5% + 0.3A) 300 to 400A: ± (3.5% + 0.6A)
	600 AAC	0 to 150A: ± (3.0% + 4A) 151 to 350A: ± (3.5% + 5A) 351 to 600A: ± (4.0% + 8A)
DC Voltage	400.0 mVDC	± (0.5% + 5 digits)
	4.000 VDC	
	40.00 VDC	± (1.2% + 3 digits)
	400.0 VDC	
	600 VDC	± (1.5% + 3 digits)
AC Voltage	4.000 VAC	± (1.0% + 5 digits)
	40.00 VAC	± (1.5% + 3 digits)
	400.0 VAC	
	600 VAC	± (2.0% + 4 digits)
Resistance	400.0 Ω	± (1.0% + 4 digits)
	4.000KΩ	
	40.00KΩ	± (1.5% + 2 digits)
	400.0KΩ	
	4.000MΩ	± (2.0% + 3 digits)
	40.00MΩ	± (3.0% + 5 digits)
Temperature	-4 to 1400°F	± (3.0% + 5 °F)
	-20 to 760 °C	± (3.0% + 3 °C)
Capacitance	40.00 nF	± (5.0% + 7 digits)
	400.0 nF	± (3.5% + 5 digits)
	4.000 uF	
	40.00 uF	
	100.0 uF	± (5.0% + 5 digits)

<b>Clamp size</b>	Opening 1.3" (33mm) approx.
<b>Diode Test</b>	Test current of 0.3mA typical; Open circuit voltage 1.5V DC typical.
<b>Continuity Check</b>	Threshold <50Ω; Test current < 1mA
<b>Low Battery Indication</b>	"BAT" is displayed
<b>OVERRANGE INDICATION</b>	"1" is displayed
<b>Measurements Rate</b>	2 per second, nominal
<b>Peak detection</b>	Response time < 10ms
<b>Temperature sensor</b>	Type K thermocouple
<b>Input Impedance</b>	7.8MΩ (VDC and VAC)
<b>Display</b>	3-3/4 digits (4000 counts) LCD
<b>AC bandwidth</b>	50/60Hz (AAC and VAC)
<b>AC response</b>	True rms (AAC and VAC)
<b>Operating Temperature</b>	14 to 122°F (-10 to 50°C)
<b>Storage Temperature</b>	-14 to 140°F (-30 to 60°C)
<b>Relative Humidity</b>	90% (0°C to 30°C); 75% (30°C to 40°C); 45% (40°C to 50°C)
<b>Altitude</b>	Operating: 3000m; Storage 10,000m
<b>Over voltage</b>	Category II 600V
<b>Battery</b>	9V Battery
<b>Auto OFF</b>	After 15 minutes of inactivity
<b>Dimensions/Weight</b>	8x3.2x1.7" (204x80x43mm)/0.62 lbs. (281g)
<b>Safety</b>	For indoor use and in accordance with Overvoltage Category II, Pollution Degree 2. Category II includes local level, appliance, portable equipment, etc., with transient overvoltage less than Overvoltage Cat. III



# Operation

**NOTICES:** Read and understand all **warning** and **precaution** statements listed in the safety section of this operation manual prior to using this meter. Set the function select switch to the OFF position when the meter is not in use.

## AC/DC Current Measurements

**WARNING:** Ensure that the test leads are disconnected from the meter before making current clamp measurements.

1. Set the Function switch to the **600 or 400A** range. If the range of the measured is not known, select the higher range first then move to the lower range if necessary.
2. Select AC or DC with the AC/DC button. Press the zero button to zero the meter in the DCA mode only.
3. Press the trigger to open jaw. Fully enclose one conductor to be measured.
4. The clamp meter LCD will display the reading.

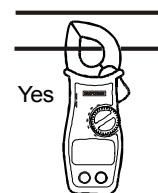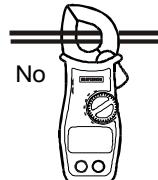

## AC/DC Voltage Measurements

1. Insert the black test lead into the negative **COM** terminal and the red test lead into the positive **V** terminal.
2. Set the function switch to the **V** position.
3. Select AC or DC with the AC/DC button.
4. Connect the test leads in parallel to the circuit under test.
5. Read the voltage measurement on the LCD display.




## Resistance and Continuity Measurements

1. Insert the black test lead into the negative **COM** terminal and the red test lead into the positive terminal.
2. Set the function switch to the  $\blacktriangleright\bullet$ )  $\Omega$  CAP position.
3. Use the multifunction button to select resistance.
4. Touch the test probe tips across the circuit or component under test. It is best to disconnect one side of the device under test so the rest of the circuit will not interfere with the resistance reading.
5. For Resistance tests, read the resistance on the LCD display.
6. For Continuity tests, if the resistance is  $< 30\Omega$ , a tone will sound.

## Capacitance Measurements

**WARNING:** To avoid electric shock, discharge the capacitor under test before measuring.

1. Set the function switch to the  $\bullet\bullet\bullet$ )  $\Omega$  CAP Position.
2. Press the multifunction button to select the capacitance function.
3. Insert the black test lead banana plug into the negative (COM) jack and the red test lead banana plug into the positive jack.
4. Touch the test probe tips across the part under test.
5. Read the capacitance in the display.
6. The display will indicate the proper decimal point and value.

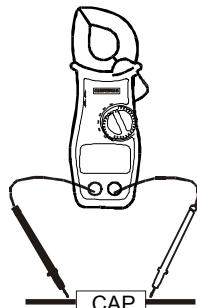

## Temperature Measurements

**WARNING:** To avoid electric shock, disconnect both test probes from any source of voltage before making a temperature measurement.

1. Set the function switch to TEMP.
2. Insert the Temperature Probe into the negative (COM) and the positive jacks, making sure to observe the correct polarity.
3. Touch the Temperature Probe head to the part whose temperature you wish to measure. Keep the probe touching the part under test until the reading stabilizes (about 30 seconds).
4. Read the temperature in the display. The digital reading will indicate the proper decimal point and value.



**WARNING:** To avoid electric shock, be sure the thermocouple has been removed before changing to another measurement function

## Data Hold

To freeze the LCD meter reading, press the data hold button. The data hold button is located on the left side of the meter (top button). While data hold is active, the DH display icon appears on the LCD. Press the data hold button again to return to normal operation.

## Peak Hold

To hold the highest reading on the LCD, press the peak hold button. The peak hold button is located on the left side of the meter (bottom button). The meter reading will not change as readings change, rather it will only display the highest reading encountered since the peak hold button was pressed. Press the peak hold button again to return to normal operation.

## **Maintenance**

**WARNING:** To avoid electrical shock, disconnect the meter from any circuit, remove the test leads from the input terminals and turn OFF the meter before opening the case. Do not operate with open case.

### **Cleaning and Storage**

Periodically wipe the case with a damp cloth and mild detergent; do not use abrasives or solvents. If the meter is not to be used for periods of longer than 60 days, remove the battery and store it separately.

### **Battery Replacement**

1. Remove the Phillips head screw that secures the battery door.
2. Open the battery compartment
3. Replace the 9V battery
4. Replace and secure the door.

### **Temperature Probe Replacement**

The replacement bead wire probe with banana plug connectors is p/n TP873.

To use type k probes with a mini plug connector requires a mini-plug to banana plug converter.

## ***Warranty***

---

**FLIR Systems, Inc. warrants this Extech Instruments brand device** to be free of defects in parts and workmanship for **one year** from date of shipment (a six month limited warranty applies to sensors and cables). If it should become necessary to return the instrument for service during or beyond the warranty period, contact the Customer Service Department for authorization. Visit the website [www.extech.com](http://www.extech.com) for contact information. A Return Authorization (RA) number must be issued before any product is returned. The sender is responsible for shipping charges, freight, insurance and proper packaging to prevent damage in transit. This warranty does not apply to defects resulting from action of the user such as misuse, improper wiring, operation outside of specification, improper maintenance or repair, or unauthorized modification. FLIR Systems, Inc. specifically disclaims any implied warranties or merchantability or fitness for a specific purpose and will not be liable for any direct, indirect, incidental or consequential damages. FLIR's total liability is limited to repair or replacement of the product. The warranty set forth above is inclusive and no other warranty, whether written or oral, is expressed or implied.

## ***Calibration, Repair, and Customer Care Services***

---

**FLIR Systems, Inc. offers repair and calibration services** for the Extech Instruments products we sell. NIST certification for most products is also provided. Call the Customer Service Department for information on calibration services available for this product. Annual calibrations should be performed to verify meter performance and accuracy. Technical support and general customer service is also provided, refer to the contact information provided below.

### **Support Lines: U.S. (877) 439-8324; International: +1 (603) 324-7800**

Technical Support: Option 3; E-mail: [support@extech.com](mailto:support@extech.com)

Repair & Returns: Option 4; E-mail: [repair@extech.com](mailto:repair@extech.com)

Product specifications are subject to change without notice

**Please visit our website for the most up-to-date information**

**[www.extech.com](http://www.extech.com)**

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

***ISO 9001 Certified***

### **Copyright © 2015 FLIR Systems, Inc.**

All rights reserved including the right of reproduction in whole or in part in any form

**[www.extech.com](http://www.extech.com)**

## **Garantie**

---

**FLIR Systems, Inc. garantit que cet appareil Extech Instruments** est exempt de défauts matériau et de fabrication pendant un an à partir de la date d'envoi (une garantie limitée de six mois s'applique aux capteurs et aux câbles). Si le renvoi de l'appareil pour réparation devient nécessaire durant ou après la période de garantie, contactez le service client pour autorisation. Pour obtenir les coordonnées, visitez le site Web suivant : [www.extech.com](http://www.extech.com). Un numéro d'autorisation de retour (AR) doit être délivré avant tout retour de produit. L'expéditeur prend à sa charge les frais d'expédition, le fret, l'assurance et l'emballage correct de l'appareil afin de prévenir toute détérioration durant le transport. Cette garantie ne s'applique pas aux dommages imputables à l'utilisateur, tels que l'usage impropre ou abusif, un mauvais câblage, une utilisation non conforme aux spécifications, un entretien ou une réparation incorrecte, ou toute modification non autorisée. FLIR Systems, Inc. déclinera spécifiquement toute garantie ou qualité marchande ou aptitude à l'emploi prévu, et ne sera en aucun cas tenu responsable pour tout dommage conséquent, direct, indirect ou accidentel. La responsabilité totale de FLIR est limitée à la réparation ou au remplacement du produit. La garantie définie ci-dessus est inclusive et aucune autre garantie, écrite ou orale, n'est exprimée ou implicite.

## **Calibrage, réparation et services après-vente**

---

**FLIR Systems, Inc. offre des services de calibrage et de réparation** pour les produits Extech Instruments que nous commercialisons. Nous fournissons également une certification NIST pour la plupart des produits. Contactez notre service client pour toute information sur les services de calibrage disponibles pour ce produit. Un calibrage doit être effectué chaque année pour vérifier les performances et la précision du mètre. Nous offrons également une assistance technique et un service à la clientèle. Veuillez vous reporter aux coordonnées fournies ci-dessous.

### **Lignes d'assistance: États-Unis (877) 439-8324; international: +1 (603) 324-7800**

Service d'assistance technique : Option 3 ; E-mail : [support@extech.com](mailto:support@extech.com)

Réparations et retours : Option 4 ; E-mail : [repair@extech.com](mailto:repair@extech.com)

Les spécifications produit sont sujettes à modifications sans préavis.

**Pour les toutes dernières informations, veuillez visiter notre site Web.**

**[www.extech.com](http://www.extech.com)**

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

**Certifié ISO 9001**

### **Copyright © 2015 FLIR Systems, Inc.**

Tous droits réservés, y compris la reproduction partielle ou totale sous quelque forme que ce soit.

**[www.extech.com](http://www.extech.com)**

## **Garantía**

---

**FLIR Systems, Inc.**, garantiza este dispositivo marca Extech Instruments para estar libre de defectos en partes o mano de obra durante un año a partir de la fecha de embarque (se aplica una garantía limitada de seis meses para cables y sensores). Si fuera necesario regresar el instrumento para servicio durante o después del periodo de garantía, llame al Departamento de Servicio a Clientes para obtener autorización. Visite [www.extech.com](http://www.extech.com) para información de contacto. Se debe expedir un número de Autorización de Devolución (AD) antes de regresar cualquier producto. El remitente es responsable de los gastos de embarque, flete, seguro y empaque apropiado para prevenir daños en tránsito. Esta garantía no se aplica a defectos resultantes de las acciones del usuario como el mal uso, alambrado equivocado, operación fuera de las especificaciones, mantenimiento o reparación inadecuada o modificación no autorizada. FLIR Systems, Inc., rechaza específicamente cualesquier garantías implícitas o factibilidad de comercialización o idoneidad para cualquier propósito determinado y no será responsable por cualesquier daños directos, indirectos, incidentales o consecuentes. La responsabilidad total de FLIR está limitada a la reparación o reemplazo del producto. La garantía precedente es inclusiva y no hay otra garantía ya sea escrita u oral, expresa o implícita.

## **Servicios de calibración, reparación y atención a clientes**

---

**FLIR Systems, Inc.**, ofrece servicios de reparación y calibración para los productos que vendemos de Extech Instruments. Además ofrecemos certificación NIST para la mayoría de los productos. Llame al Departamento de Servicio al Cliente para solicitar información de calibración para este producto. Para verificar el funcionamiento y precisión se debe realizar la calibración anual. Además se provee Soporte Técnico y servicios generales al cliente, consulte la información de contacto en seguida.

**Líneas de soporte: EE.UU. (877) 439-8324; Internacional: +1 (603) 324-7800**

Soporte Técnico Opción 3; correo electrónico: [support@extech.com](mailto:support@extech.com)

Reparación / Devoluciones: Opción 4; correo electrónico: [repair@extech.com](mailto:repair@extech.com)

Las especificaciones del producto están sujetas a cambios sin aviso

**Por favor visite nuestra página en Internet para la información más actualizada**

**[www.extech.com](http://www.extech.com)**

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

**Certificado ISO 9001**

**Copyright © 2015 FLIR Systems, Inc.**

Reservados todos los derechos, incluyendo el derecho de reproducción total o parcial en cualquier medio

**[www.extech.com](http://www.extech.com)**